


UNITÀ DI MASCHIATURA - TAPPING UNIT GEWINDESCHNEIDEINHEIT - UNITE DE TARAUDAGE - UNIDAD DE ROSCAR

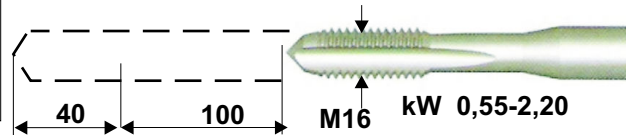

ORDERING REFERENCES

T16/D/4.0/00B/1/ *

T= UNITÀ DI MASCHIATURA - TAPPING UNIT -
UNITE DE TARAUDAGE - GEWINDESCHNEIDEINHEIT -
UNIDAD DE ROSCAR

16= M16 CAPACITÀ MASCHIATURA SU ACCIAIO
TAPPING CAPACITY IN STEEL
CAPACITE TARAUDAGE ACIER
SCHNEIDLEISTUNGEN IN STAHL
CAPACIDAD ROSCAR EN ACERO
500N/ mm²

D= CORSA RAPIDA 100 mm +CORSA MASCHIATURA 0-40 mm
FAST STROKE 100 mm+TAPPING STROKE 0-40 mm
COURSES RAPIDE 100 mm+TARAUDAGE 0-40 mm
EILVORSCHUB 100 mm+ARBEITSVORSCHUB 0-40 mm
CARRERA RAPIDA 100 mm+CARRERA DE ROSCAR 0-40mm

4.0= MORSE 2 DIN 228 STANDARD
5.0= ER20
7.0= DIN 55058 Ø20
8.0= B18 DIN 238

MANDRINO
TOOLHOLDER
NEZ DE BROCHE
WERKZEUGAUFNAHME
HUSILLO

00= 80- kW 0,75- POLES 4 STANDARD
80- kW 0,55- POLES 6 STANDARD
01= 90- kW 1,10 POLES 4
02= 90- kW 1,50 POLES 4
03= 90- kW 0,75 POLES 6
04= 90- kW 1,10 POLES 6
07= 100- kW 2,20 POLES 4
08= 100- kW 1,50 POLES 6

MOTORE
MOTOR
MOTEUR
MOTOR

B= MOTORE AUTOFRENANTE- BRAKE MOTOR -
MOTEUR FREIN- BREMSMOTOR -
MOTOR CON AUTOFRENADO

OPTION

PASSO PATRONA - LEAD SCREW PITCH -
PAS DE LA PATRONNE - STEIGUNG DER LEITPATRONE-
PASO HUSILLO PATRÓN

Riduttore - Reducer - Réducteur
Getriebe - Reductor

HZ50 HZ60 MOTOR
1R= 130 156 4 POLES
2R= 160 192 4 POLES

GIRI MANDRINO
SPINDLE RPM
VITESSE DE BROCHE
SPINDEL DREHZAHL
VELOCIDAD HUSILLO

06B2 3R= 200 240 4 POLES
1 = 340 408 6 POLES
2 = 530 636 6 POLES

Catena - Chain - Chaîne
Kette - Cadena

06B 3 = 700 840 6 POLES

Cinghia dentata
Timing belt

8 = 610 730 4 POLES

Courroie crantée
Zahnriemen

9 = 1000 1200 4 POLES


Correa dentada
L100

9a = 1200 1440 4 POLES
10 = 1500 1800 4 POLES


Altre velocità a richiesta - Other rpm on request - Autres
vitesses sur demand - Andere Drehzahl auf Anfrage -
Otras velocidades a solicitud



33

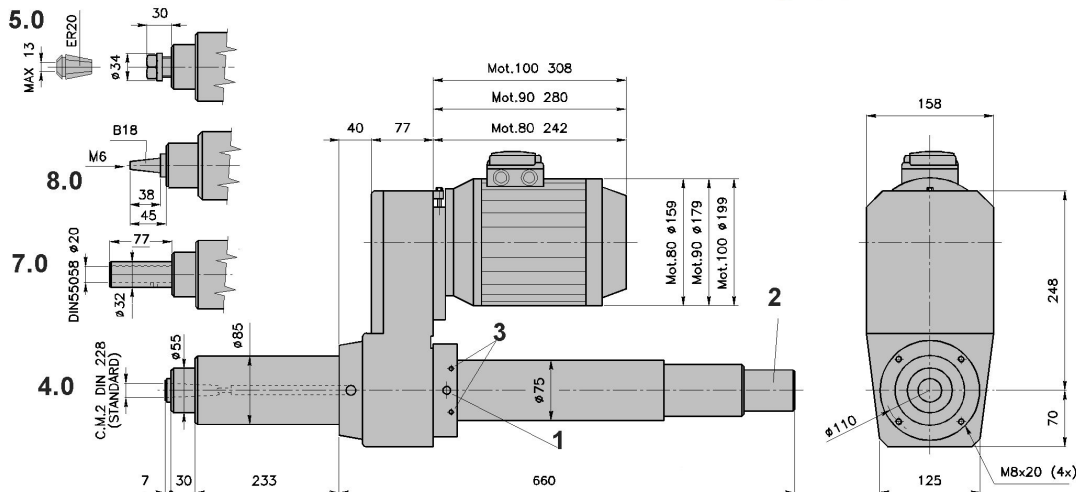

Page 90

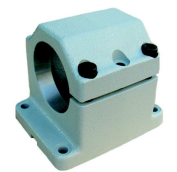

Page 92



	I	GB	F	D	E
1	PG11 Ingresso cavi per fine corsa elettrici interni. (Sensori induttivi in opzione).	PG11 Electric wires connections for electric limit switches. (Proximity sensors as option).	PG11 Passage câble des fins de course électriques. (Capteurs inductifs en option).	PG11 Kabelanschluss der Endschalter. (Induktive Endschalter (Option)).	PG11 Conexión por interruptores eléctricos. Sensores en opción.
2	Patrona in bagno d'olio. Cambio patrona facile. Sicurezza per patrona.	Lead screw in oil bath. Easy to change lead screw. Load sensing safety switch.	Patronne à bain d'huile rapide-ment interchangeable. Fin de course sécurité patronne.	Ölbadschmierung der Leitspindel. Schnelles Auswechseln de Leit-spindel. Kernlochkontrolle.	Patrón en baño de aceite. Fácil sustitución del patrón. Control piezas sin agujero.
3	Corso rapida 50mm pneumatica. raccordi G1/8 - 6 bar. Consumo aria/ciclo NL 1,6.	Pneumatic rapid advance 50mm. air ports G1/8- 6 bar. Air consumption/cycle NL 1,6.	Avance rapide pneumat. 50mm. raccordements G1/8- 6 bar. Consommation air/cycle NL 1,6.	Pneumatischer Eilvorschub 50mm. Luftanschluss G1/8- 6 bar. Luftverbrauch / Zyklus NL 1,6.	Carrera rápida neumática 50mm. conexiones G1/8 - 6 bar. Consumo aire/ciclo NL 1,6.
	Peso kg 40-61 Colore Grigio RAL 7038	Weight kg 40-61 Color grey RAL 7038	Poids kg 40-61 Couleur gris RAL 7038	Gewicht kg 40-61 Farbe hellgrau RAL 7038	Peso kg 40-61 Color gris RAL 7038