


UNITÀ DI MASCHIATURA - TAPPING UNIT
GEWINDESCHNEIDEINHEIT -
UNITE DE TARAUDAGE - UNIDAD DE ROSCAR

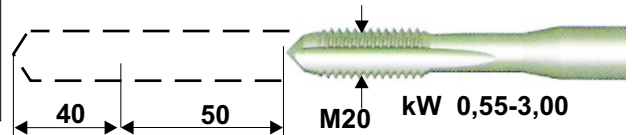

ORDERING REFERENCES

T20/C/4.0/00B/1/ *

T= UNITÀ DI MASCHIATURA - TAPPING UNIT -
 UNITE DE TARAUDAGE - GEWINDESCHNEIDEINHEIT -
 UNIDAD DE ROSCAR

20= M20 CAPACITÀ MASCHIATURA SU ACCIAIO
 TAPPING CAPACITY IN STEEL
 CAPACITE TARAUDAGE ACIER
 SCHNEIDLEISTUNGEN IN STAHL
 CAPACIDAD ROSCAR EN ACERO 500N/mm²

C= CORSA RAPIDA 50 mm+CORSA MASCHIATURA 0-40 mm
 FAST STROKE 50 mm+TAPPING STROKE 0-40 mm
 COURSES RAPIDE 50mm+TARAUDAGE 0-40mm
 EILVORSCHUB 50 mm+ARBEITSVORSCHUB 0-40 mm
 CARRERA RAPIDA 50 mm+CARRERA DE ROSCAR 0-40mm

4.0= MORSE 2 DIN 228 STANDARD

5.0= ER20

6.0= DIN 55058 Ø16

7.0= DIN 55058 Ø20

11.0= ER25

**MANDRINO
 TOOLHOLDER
 NEZ DE BROCHE
 WERKZEUGAUFNAHME
 HUSILLO**

00= 80- kW 0,75- POLES 4 STANDARD

80- kW 0,55- POLES 6 STANDARD

01= 90- kW 1,10 POLES 4

02= 90- kW 1,50 POLES 4

03= 90- kW 0,75 POLES 6

04= 90- kW 1,10 POLES 6

07= 100- kW 2,20 POLES 4

08= 100- kW 1,50 POLES 6

09= 100- kW 3,00 POLES 4

B= MOTORE AUTOFRENANTE - BRAKE MOTOR -
 MOTEUR FREIN. - BREMSMOTOR -
 MOTOR CON AUTOFRENADO

OPTION

Coppia max trasmissibile - Max transmission torque
 Couple max. transmissible - Max übertragbares Drehmoment
 Momento torsional transmissible 80Nm

**PASSO PATRONA - LEAD SCREW PITCH -
 PAS DE LA PATRONNE - STEIGUNG DER LEITPATRONE -
 PASO HUSILLO PATRÓN**

Riduttore - Reducer - Réducteur
 Getriebe - Reductor

HZ50 HZ60 MOTOR

1R= 130 156 4 POLES

2R= 160 192 4 POLES

3R= 200 240 4 POLES

**GIRI MANDRINO
 SPINDLE RPM
 VITESSE DE BROCHE
 SPINDELDREHZAHL
 VELOCIDAD HUSILLO**

06B2

1 = 340 408 6 POLES

2 = 530 636 6 POLES

3 = 700 840 6 POLES

Catena - Chain - Chaîne
 Kette - Cadena

06B

8 = 610 730 4 POLES

9 = 1000 1200 4 POLES


9a= 1200 1440 4 POLES

10 = 1500 1800 4 POLES


Altre velocità a richiesta - Other rpm on request - Autres
 vitesses sur demand - Andere Drehzahl auf Anfrage -
 Otras velocidades a solicitud



Page 90

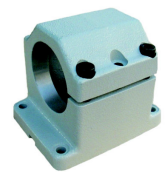

Page 92

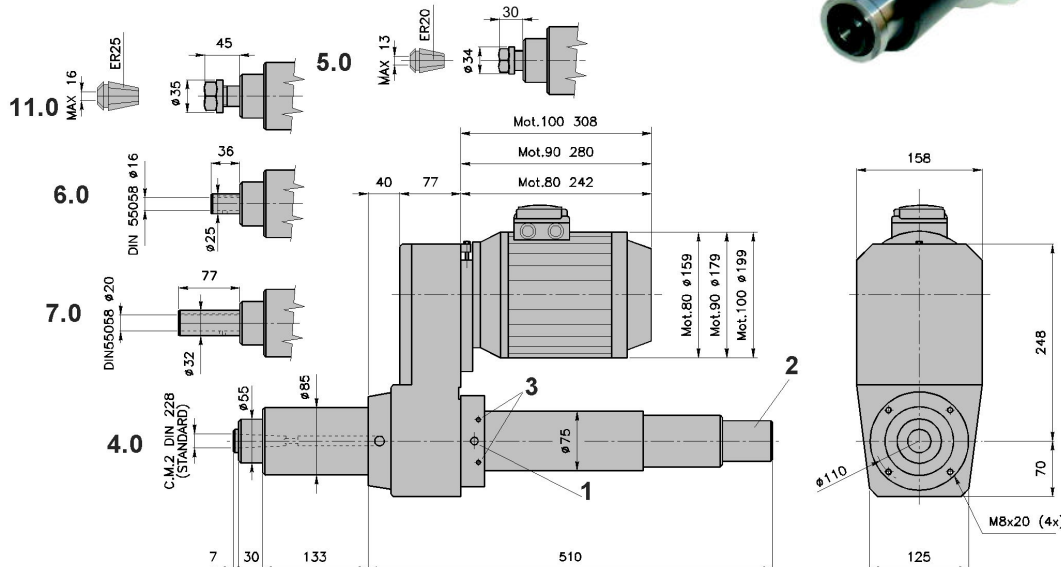

	I	GB	F	D	E
1	PG11 Ingresso cavi per fine corsa elettrici interni. (Sensori induttivi in opzione).	PG11 Electric wires connections for electric limit switches. (Proximity sensors as option).	PG11 Passage câble des fins de course électriques. (Capteurs inductifs en option).	Pg11 Kabelanschluss der Endschalter. (Induktive Endschalter (Option)).	PG11 Conexión por interruptores eléctricos. Sensores en opción.
2	Patrona in bagno d'olio. Cambio patrona facile. Sicurezza per patrona.	Lead screw in oil bath. Easy to change lead screw. Load sensing safety switch.	Patronne à bain d'huile rapidement interchangeable. Fin de course sécurité patronne.	Ölbadschmierung der Leitspindel. Schnelles Auswechseln de Leitspindel. Kernlochkontrolle.	Patrón en baño de aceite. Fácil sustitución del patrón. Controllo piezas sin agujero.
3	Corso rapida 50mm pneumatica. raccordi G1/8 - 6 bar. Consumo aria/ciclo NL 0,8.	Pneumatic rapid advance 50mm. air ports G1/8 - 6 bar. Air consumption/cycle NL 0,8.	Avance rapide pneumatique 50mm. raccordements G1/8 - 6 bar. Consommation air/cycle NL 0,8.	Pneumatischer Eilvorschub 50mm. Luftanschluss G1/8 - 6 bar. Luftverbrauch / Zyklus NL 0,8.	Carrera rápida neumática 50mm. conexiones G1/8 - 6 bar. Consumo aire/ciclo NL 0,8.
	Peso kg 36-58 Color Grigio RAL 7038	Weight kg 36-58 Color grey RAL 7038	Poids kg 36-58 Couleur gris RAL 7038	Gewicht kg 36-58 Farbe hellgrau RAL 7038	Peso kg 36-58 Color gris RAL 7038